LIG	0
-----	---

<u>California Institute of Technology</u> Massachusetts institute of Technology

	DCN No.	E010181-00-0
--	---------	--------------

Document Change Notice (DCN)

Sheet 1 of 1

DOCUMENT No. (DOC-REV-GP.ID)	TITLE	NEW REV
D980013-D	LOS Suspension Controller	D1
CHANGE DESCRIPTION	ON (FROM/TO):	

Two stages (4 poles) of the 10 pole chebychev filter need to be removed for each degree of freedom. The steps are as follows:

- 1. Remove resistors R111, R126, R155, R300.
- 2. Remove op amp output connection to R115, R130, R159, R195. This is best done by "standing up" the resistor.
- 3. Place wire from "input" side of R111, R126, R155, R330 to "input" side of R115, R130, R161, R195. (reference schematic D980013-D1.
- 4. Remove coil driver compensation by removing capacitors C23, C35, C45, C153 and resistors R63, R79, R96, R186. This stage is not necessary since the coil drivers are always run in the "acquire" mode.

REASON FOR CHANGE:Eliminate excess sensor noise feedthrough in the frequency band from 1 to 10Hz.							
ACTION: Incorporate Change	□Atta	ch DCN to Drawings	Other Action (specify):				
DISPOSITION OF HARDWARE (IDENTIFY SERIAL NUMBERS)		DCN DISTRIBUTION					
No hardware was affected (record change only)		Barish Coles Lazzarini Lindequist Shoemaker Stapfer Weiss Whitcomb	Tyler				
List S/Ns which comply already:							
☐ List S/Ns to be reworked/scrapped:							
☐ List S/N's to be built with this change:							
☐ List S/Ns to be retested per this change:							
Upgrade all units where excess noise is							
SAFETY, COST, SCHEDULE, REQUIREMEN	TS IMPACT	T? NO YES (If Y	YES, enter CR (CCB) or TCP (TRB) #)			
APPROVALS:	DATE	OTHER APPROVALS (SPE	CCIFY)	DATE			
ORIGINATOR: Heefner	10/8/01						
TASK LEADER:							
GROUP LEADER:							
DCC RELEASE:]					